# MACH 6

200 kHz Energy Meter



# AVAILABLE MODELS

 M6-6-Si 6 mm Ø, Silicon Sensor (0.35-1.1 µm)

6 mm Ø, Silicon Sensor (0.35-1.1 μm), Low Noise Level M6-6-Si-L

M6-6-In 6 mm Ø, InGaAs Sensor (1.0-1.6 µm)

6 mm Ø, InGaAs Sensor (1.0-1.6  $\mu$ m), Low Noise Level • M6-6-In-L

 M6-6-PY 6 mm Ø, Pyroelectric Sensor with Metallic Coating (0.35-2.5  $\mu$ m) 12.5 mm Ø, Pyroelectric Sensor with Metallic Coating (0.35-2.5 μm) • M6-12.5-PY

All M6 heads need to be used with the Mach 6 Energy Meter

# KEY FEATURES

## 1. UP TO 200 kHz PULSE-TO-PULSE

Measure EVERY pulse, with no sampling, at high rep rates, up to 200 kHz

## 2. CAPTURE AND STORE UP TO 4 MILLION **PULSES**

Store 40 seconds of data at 100 kHz

## 3. TRACK MISSING PULSES AND PULSES **BELOW THRESHOLD**

Know how many pulses were missed or that didn't make the energy threshold with this unique pulse feature

## SEVERAL HEADS TO CHOOSE FROM

Silicon, InGaAs and Pyroelectric heads for a broad wavelength and energy range

#### ANALOG MODULE AVAILABLE

Use our fast M6 Detectors with the APM and an oscilloscope for fast analog energy measurements

## 6. FULL-SPEED USB 2.0 CONNECTION

Ensures high data rate transfer and fast operation

## 7. USER-FRIENDLY SOFTWARE WITH MANY **DIAGNOSTIC FEATURES**

- Live Mode, Strip Chart, Histogram and Statistics
- FFT display of pulse energy data for temporal diagnostics
- Life Test Mode to automate laser testing

# **ACCESSORIES**





APM Analog Power Supply



Additional 9V Power Supply (Model Number: 200960)



M6-UV-QED Relative Measurements in UV



(Model Number: 202373)



Pelican Carrying Case

# SEE ALSO

TECHNICAL DRAWINGS **COMPATIBLE MODULES** 

> MACH 6 APM



LIST OF ALL ACCESSORIES APPLICATION NOTES:

PULSE-TO PULSE MEASUREMENTS

AT 130 KHZ 201923

MEASUREMENT LIMITS USING

**JOULEMETERS** 

201932

62

194

Watch the Demo video available on our website at www.gentec-eo.com

# MACH 6

WEEE/RA COMPLIA

# **SPECIFICATIONS**

MACH 6	M6-6-Si	M6-6-Si-L	M6-6-In	M6-6-In-L	M6-6-PY	M6-12.5-PY
MAX ENERGY	200 μJ	2 μJ	200 μJ	2 μJ	20 mJ	200 mJ
MAX AVERAGE POWER	5 W	5 W	5 W	5 W	5 W	25 W
MAX REP RATE	200 000 Hz	200 000 Hz	200 000 Hz	200 000 Hz	200 000 Hz	200 000 Hz
EFFECTIVE APERTURE	6 mm Ø	6 mm Ø	6 mm Ø	6 mm Ø	6 mm Ø	12.5 mm Ø
MEASUREMENT CAPABILITY	With Mach 6	With Mach 6	With Mach 6	With Mach 6	With Mach 6	With Mach 6
Spectral Range	0.35 - 1.1 μm	0.35 - 1.1 μm	0.9 - 1.6 μm	0.9 - 1.6 μm	0.35 - 2.5 μm	0.35 - 2.5 μm
Max Measurable Energy <sup>a</sup>	200 μJ	2 μJ	200 μJ	2 μJ	20 mJ	200 mJ
Noise Equivalent Energy	2 nJ	20 pJ	2 nJ	20 pJ	0.2 μJ	2 μJ
D. T.	150	450	4.50	.=-		100

Max Measurable Energy <sup>a</sup>	200 μJ	2 μJ	200 μJ	2 μJ	20 mJ	200 mJ
Noise Equivalent Energy	2 nJ	20 pJ	2 nJ	20 pJ	0.2 μJ	2 μJ
Rise Time (0-100%)	150 ns	150 ns				
Max Repetition Rate	200 000 Hz	200 000 Hz				
Max Pulse Width	100 nsec	100 nsec				
Calibration Uncertainty	± 4%	± 4%	± 4%	± 4%	± 4%	± 4%
Repeatability	± 1%	± 1%	± 1%	± 1%	± 1%	± 1%
DAMAGE THRESHOLDS						
Max Avg Power (60 seconds)	5 W	5 W	5 W	5 W	5 W	25 W
Max Probe Energy (@ 1064 nm)	200 μJ	2 μJ	200 μJ	2 μJ	20 mJ	200 mJ
PHYSICAL CHARACTERISTICS						
Effective Aperture	6 mm Ø	12.5 mm Ø				
Sensor	Silicon	Silicon	InGaAs	InGaAs	Pyroelectric	Pyroelectric
Dimensions	38.1 Ø x 58.4D mm	76H x 111W x 76D				
Weight (Head only)	150 g	N/A				

ORDERING INFORMATION						
Product Name	M6-6-Si	M6-6-Si-L	M6-6-In	M6-6-In-L	M6-6-PY	M6-12.5-PY
Product Number (without stand)	202115	202116	202117	202118	202119	202120
Module	Mach 6: 202090					

Specifications are subject to change without notice // Compatible stand: P/N 200428

a. Maximum pulse energy reading will vary with wavelength and probe voltage responsivity (Rv). For more details, please read Application Note 121D-201932 and contact us at info@gentec-eo.com

# MACH 6



# MACH 6 JOULEMETER

Measure every pulse at up to 200 kHz with MACH 6. Measure with 12-bit digital accuracy and capture up to 4 million pulses in real time. Our MACH 6 Joulemeter is the only instrument in the world that performs at this speed, and with this precision. It is designed to support our full complement of fast energy probes that include Silicon, InGaAs and Pyroelectric Detectors. Measure from pJ to mJ and from 0.35 to  $2.5 \mu m$ . Using the M6-Si detector and the M6-UV-QED accessory, you can make relative measurements at 266 nm.



# SPECIFICATIONS & FEATURES

	MACH 6
Compatible Detector Heads	M6
Maximum Repetition Rate	200 000 Hz
Analog Output	0-3 V
External Trigger (TTL)	Optically Coupled
Internal Trigger	2-20 %
Trigger Delay (User-Selectable)	38-3825 ns
Computer Input Connector	USB2.0
Product Number	202090


# INSTRUMENT CONTROL SCREEN

Our powerful LabView Application Software includes many unique control and diagnostic features. The Instrument Control Screen, shown on the left, is used to set up the operation of the MACH 6, including range, trigger, wavelength, and more. In addition, it is used to set a pulse batch size and to ARM the instrument, which starts the data collection. It also gives you access to features like "Autoset", "Call Live Mode", "Run Life Test", "Save Instrument Setup" and the like. These features can be accessed by clicking directly on the feature or pushing the associated function key.




# LIVE MODE DISPLAY

The Live mode can be accessed from the Instrument Control Screen, or by simply pressing the "F4" function key on your PC. This mode of operation is intended to act like your typical slower Digital Joulemeter, as it samples the laser pulses at a 10 Hz rate. It provides you with an energy strip chart, live energy reading, statistics and repetition rate. It is a very useful mode when setting up the Mach 6 with your laser. You can select "Auto Set", where the instrument runs through the ranges and trigger levels until it finds the correct range, or set them manually. When setup is complete, you will exit this screen and return to the "Control" screen where you will select a Batch Size, Arm the instrument and start taking pulse energy data.

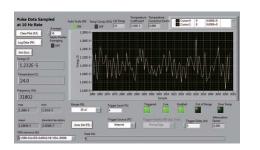

**OEM DETECTORS** 

# MACH 6

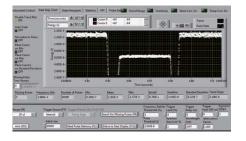

# STRIP CHART

The Strip Chart Display provides a quick graphical look at the pulse data batch just collected. The data can be displayed in full scale or in auto scale mode. You can also zoom-in on a portion of the data, like shown in the screen on the left. An ND0.3 filter has been dropped through the beam and you can see the effects on the pulse data collected. You can fit trend and min/max lines to the data. Just below the chart, you will find a complete set of statistics for the batch. At the top of this screen you will see tabs that will take you to the Histogram, Statistics, and FFT (Fast Fourier Transform) displays.


# 1.92 W

# **HISTOGRAM**

Interested in viewing the statistical distribution of the pulse energy data set? The Histogram screen does this for you and fits a "best Gaussian curve" to the data. It displays complete statistical calculations along the bottom of the graph, along with pulse frequency. Just below the statistics, you will find instrument controls, like range and trigger. You are also given the ability to adjust trigger delay and hold off as needed.

# **STATISTICS**

The Statistics Display offers a very complete set of useful energy readings and calculated statistics. These include: minimum, maximum, average (mean), standard deviation, spread and variation. Some other very handy features include: windows displaying, Average Frequency, Pulse Jitter, Pulses Below Trigger and Pulses Below Threshold (a level set by you). In the screen on the left, you can see that there were 12 pulses below an energy threshold of  $3 \mu W$ , and 147 missing pulses (or pulses below trigger).

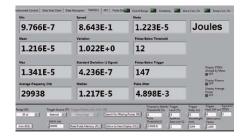

# LIFE TEST MODE

〒336-0017 埼玉県さいたま市南区南浦和 1-2-17

TEL:048-871-0067 FAX:048-871-0068

Would you like to run a life test on your high repetition rate pulsed laser? How about a periodic test vs. an environmental change like temperature? We have included a great feature to accomplish this. In the Life Test screen, we give you the ability to select the statistics you want, a start time and date, a stop time and date, the number of pulses and a test interval. You simply identify a file, a place to put the data, and then click on start and walk away! When you come back, you have a data set that tracked the performance of your laser over time, temperature, shock, vibration or anything you chose.

